





D/C SERIES

CARBON BRUSH MOTOR


SPECIFICATIONS

Model clutch type	OS-4C07	OS-4C15	OS-5C25	OS-5C35	OS-6C25	OS-6C35	OS-SC25	OS-SC35
Model shut off type	OS-4D07	OS-4D15	OS-5D25	OS-5D35	OS-6D25	OS-6D35	OS-SD25	OS-SD35
Input voltage	110V~240V 50/60Hz							
Torque range adjustment	Stepless adjustment							
Torque range Nm (kgf/cm ²)	0.05~0.7(0.5~7)	0.2~1.5(2~15)	0.3~2.5(3~25)	0.5~3.5(5~35)	0.3~2.5(3~25)	0.5~3.5(5~35)	0.3~2.5(3~25)	0.5~3.5(5~35)
No load speed R.P.M	1000~1400	1000~1400	1000~1500	1000~1500	700~1100	700~1100	700~1100	700~1100
Rated power W	60	60	80	80	80	80	80	80
Weight kg	0.25	0.25	0.45	0.45	0.45	0.45	0.45	0.45
Screw size	Machine screw	1.2~4.0	1.2~4.0	1.6~5.0	1.6~5.0	2.0~6.0	2.0~6.0	2.0~6.0
	Tapping screw	1.2~3.5	1.2~3.5	1.6~4.5	1.6~4.5	2.0~5.5	2.0~5.5	2.0~5.5
Bits type								

POWER SUPPLY SPECIFICATION



Model	OS-60E	OS-60D	OS-60W
Input Voltage	110V~240V 50~60Hz		
Function	automatic constant pressure control / voltage stepless adjustment		
Rated Power	80W	160W	160W

APPROXIMATE GUIDANCE OF OUTPUT TORQUE

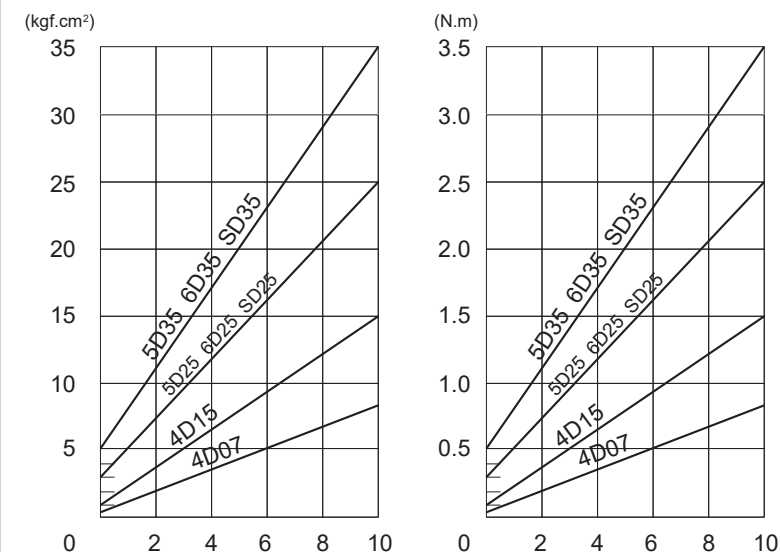

D/C SERIES

CARBON BRUSH MOTOR

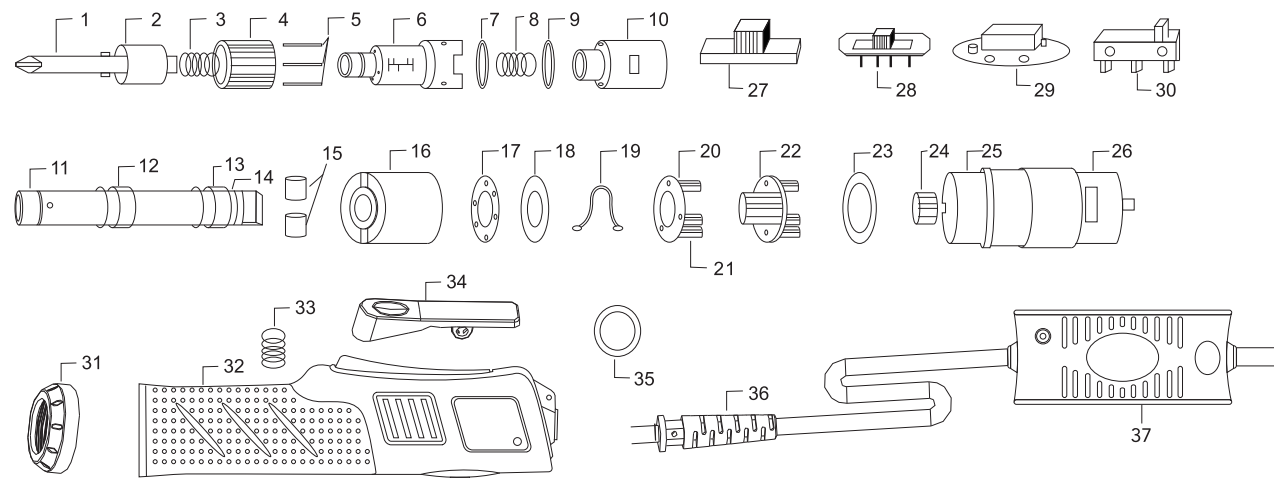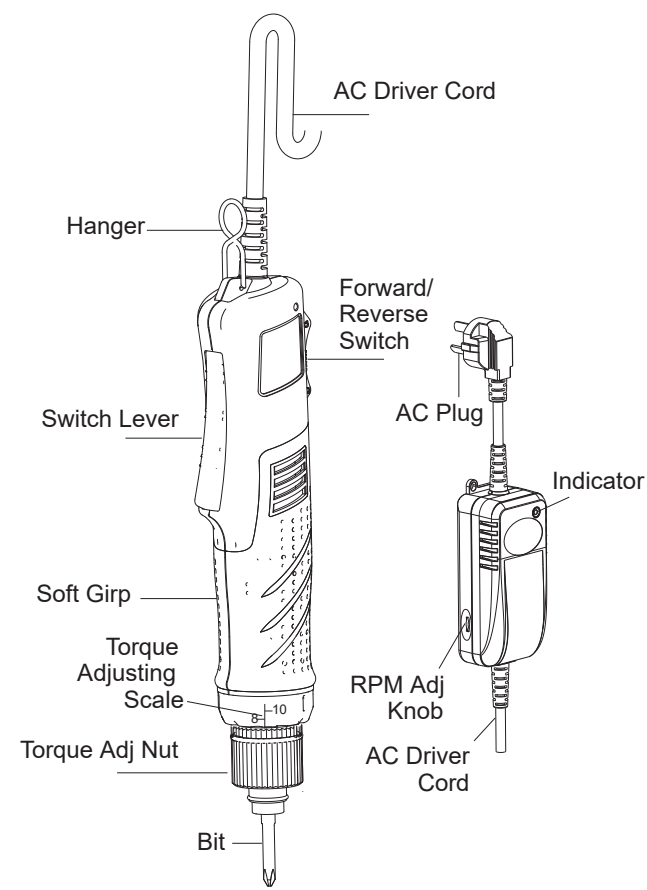

PARTS LIST

No.	Name	QTY	No.	Name	QTY	No.	Name	QTY	No.	Name	QTY
1	Bit	1	11	Anvil axis	1	21	Planet gear	6	31	Handle cap	1
2	Locking sleeve	1	12	Front bearing	1	22	Planet gear carrier2	1	32	Soft grip	1
3	Locking sleeve spring	1	13	Rear bearing	1	23	Gasket	1	33	Switch lever spring	1
4	Torque adjustment nut	1	14	Circlip	1	24	Motor gear	1	34	Switch lever	1
5	Pin	3	15	Roller pin	2	25	Contector	1	35	Hanger	1
6	Torque seat	1	16	Inner gear	1	26	Carbon brush motor	1	36	Wire	1
7	Gasket	1	17	Flat bearing	1	27	Changeover switch cap	1	37	Power supply	1
8	Torque spring	1	18	Bearing pedestal	1	28	Changeover switch	1			
9	Gasket	1	19	Circlip	1	29	Circuit board	1			
10	Cabinet	1	20	Planet gear carrier1	1	30	Tirgger switch	1			

(To order spare parts, according to the above number)